

Work Order ID 79745

79745

Page 1

February-01-12 1:30:49 PM

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 01/02/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 15/02/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: M.L.J

Date: 12/02/10 Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D407-667-245	Rev F								

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8531 on both ends as per Folio FA248

2-Turn first side as per Folio FA248

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: AA

DWG REV: F

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

mm.l 12/03/14

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

mm.l 12/03/14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 79745***79745***

Page 2

February-01-12 1:30:49 PM

Item ID: D407-667-205TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 01/02/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 15/02/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA248

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: AADWG REV: E

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D407-667-245

Inside of Cuff(Donot engrave on outside of tube)

Mm.L 12/03/14

130

QC1- Inspect dimensions to dimension sheet

0.00

130

QC

Memo

0.00

Quality Control

Mm.L 12/03/14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 79745***79745***

Page 3

February-01-12 1:30:49 PM

Item ID: D407-667-205TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 01/02/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 15/02/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140 QC8- Inspect parts - second check 0.00

140

QC

Memo

0.00

Quality Control



12-3-15

145 0.00

145

Crosstubes

Memo

0.00

Crosstubes

Grind off circumferential machining marks longitudinally.



12-3-16

150 Crosstubes Chemical Conversion 0.00

150

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

Ensure no sand is in the tube before alodine.



12-3-16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

79745

Page 4

N900040100

Setup Start *NS1*

Stop *NS2*

*** 1 ***

Cust Item ID:

*** 1 ***

Customer:

Reference:

Run Start *NR1*

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop *NR2*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

160

QC3- Inspect Part Finish

0.00

160

OC

Memo

0.00

Quality Control

170

0.00

170

Packaging

Packaging

Memo

0.00.

Packaging

Identify and stock in kanban rack Location: *W/G*

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.00

Quality Control

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February-01-12 1:30:52 PM

Page 1

Work Order ID: 79745

79745

Parent Item: D407-667-205TRN

D407-667-205TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 01/02/2012

Required Date: 15/02/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
 IPP Rev B 08.04.02 Removed polish EC verified by: DD
 IPP Rev:C 08-08-19 revE as per dwg DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6011-115		Manufactured	No			120	Each	23.0000	1	1			

D6011-115

Crosstube Material

**

Location

Loc Qty

Loc Code

LG

23

65180

1

67798

22

_____ 1

_____ 2

_____ 3

_____ 4

_____ 5

_____ 6

_____ 7

_____ 8

_____ 9

_____ 10

_____ 11

_____ 12

_____ 13

_____ 14

_____ 15

_____ 16

_____ 17

_____ 18

_____ 19

_____ 20

_____ 21

_____ 22

_____ 23

_____ 24

_____ 25

_____ 26

_____ 27

_____ 28

_____ 29

_____ 30

_____ 31

_____ 32

_____ 33

_____ 34

_____ 35

_____ 36

_____ 37

_____ 38

_____ 39

_____ 40

_____ 41

_____ 42

_____ 43

_____ 44

_____ 45

_____ 46

_____ 47

_____ 48

_____ 49

_____ 50

_____ 51

_____ 52

_____ 53

_____ 54

_____ 55

_____ 56

_____ 57

_____ 58

_____ 59

_____ 60

_____ 61

_____ 62

_____ 63

_____ 64

_____ 65

_____ 66

_____ 67

_____ 68

_____ 69

_____ 70

_____ 71

_____ 72

_____ 73

_____ 74

_____ 75

_____ 76

_____ 77

_____ 78

_____ 79

_____ 80

_____ 81

_____ 82

_____ 83

_____ 84

_____ 85

_____ 86

_____ 87

_____ 88

_____ 89

_____ 90

_____ 91

_____ 92

_____ 93

_____ 94

_____ 95

_____ 96

_____ 97

_____ 98

_____ 99

_____ 100

_____ 101

_____ 102

_____ 103

_____ 104

_____ 105

_____ 106

_____ 107

_____ 108

_____ 109

_____ 110

_____ 111

_____ 112

_____ 113

_____ 114

_____ 115

_____ 116

_____ 117

_____ 118

_____ 119

_____ 120

_____ 121

_____ 122

_____ 123

_____ 124

_____ 125

_____ 126

_____ 127

_____ 128

_____ 129

_____ 130

_____ 131

_____ 132

_____ 133

_____ 134

_____ 135

_____ 136

_____ 137

_____ 138

_____ 139

_____ 140

_____ 141

_____ 142

_____ 143

_____ 144

_____ 145

_____ 146

_____ 147

_____ 148

_____ 149

_____ 150

_____ 151

_____ 152

_____ 153

_____ 154

_____ 155

_____ 156

_____ 157

_____ 158

_____ 159

_____ 160

_____ 161

_____ 162

_____ 163

_____ 164

_____ 165

_____ 166

_____ 167

_____ 168

_____ 169

_____ 170

_____ 171

_____ 172

_____ 173

_____ 174

_____ 175

_____ 176

_____ 177

_____ 178

_____ 179

_____ 180

_____ 181

_____ 182

_____ 183

_____ 184

_____ 185

_____ 186

_____ 187

_____ 188

_____ 189

_____ 190

_____ 191

_____ 192

_____ 193

_____ 194

_____ 195

_____ 196

_____ 197

_____ 198

_____ 199

_____ 200

_____ 201

_____ 202

_____ 203

_____ 204

_____ 205

_____ 206

_____ 207

_____ 208

_____ 209

_____ 210

_____ 211

_____ 212

_____ 213

_____ 214

_____ 215

_____ 216

_____ 217

_____ 218

_____ 219

_____ 220

_____ 221

_____ 222

_____ 223

_____ 224

_____ 225

_____ 226

_____ 227

_____ 228

_____ 229

_____ 230

_____ 231

_____ 232

_____ 233

_____ 234

_____ 235

_____ 236

_____ 237

_____ 238

_____ 239

_____ 240

_____ 241

_____ 242

_____ 243

_____ 244

_____ 245

_____ 246

_____ 247

_____ 248

_____ 249

_____ 250

_____ 251

_____ 252

_____ 253

_____ 254

_____ 255

_____ 256

_____ 257

_____ 258

_____ 259

_____ 260

_____ 261

_____ 262

_____ 263

_____ 264

_____ 265

_____ 266

_____ 267

_____ 268

_____ 269

_____ 270

_____ 271

_____ 272

_____ 273

_____ 274

_____ 275

_____ 276

_____ 277

_____ 278

_____ 279

_____ 280

_____ 281

_____ 282

_____ 283

_____ 284

_____ 285

_____ 286

_____ 287

_____ 288

_____ 289

_____ 290

_____ 291

_____ 292

_____ 293

_____ 294

_____ 295

_____ 296

_____ 297

_____ 298

_____ 299

_____ 300

_____ 301

_____ 302

_____ 303

_____ 304

_____ 305

_____ 306

_____ 307

_____ 308

_____ 309

_____ 310

_____ 311

_____ 312

_____ 313

_____ 314

_____ 315

_____ 316

_____ 317

_____ 318

_____ 319

_____ 320

_____ 321

_____ 322

_____ 323

_____ 324

_____ 325

_____ 326

_____ 327

_____ 328

_____ 329

_____ 330

_____ 331

_____ 332

_____ 333

_____ 334

_____ 335

_____ 336

_____ 337

_____ 338

_____ 339

_____ 340

_____ 341

_____ 342

_____ 343

_____ 344

_____ 345

_____ 346

_____ 347

_____ 348

_____ 349

_____ 350

_____ 351

_____ 352

_____ 353

_____ 354

_____ 355

_____ 356

_____ 357

_____ 358

_____ 359

_____ 360

_____ 361

_____ 362

_____ 363

_____ 364

_____ 365

_____ 366

_____ 367

_____ 368

_____ 369

_____ 370

_____ 371

_____ 372

_____ 373

_____ 374

_____ 375

_____ 376

_____ 377

_____ 378

_____ 379

_____ 380

_____ 381

_____ 382

_____ 383

_____ 384

_____ 385

_____ 386

_____ 387

_____ 388

_____ 389

_____ 390

_____ 391

_____ 392

_____ 393

_____ 394

_____ 395

_____ 396

_____ 397

_____ 398

_____ 399

_____ 400

_____ 401

_____ 402

_____ 403

_____ 404

_____ 405

_____ 406

_____ 407

_____ 408

_____ 409

_____ 410

_____ 411

_____ 412

_____ 413

_____ 414

_____ 415

_____ 416

_____ 417

_____ 418

_____ 419

_____ 420

_____ 421

_____ 422

_____ 423

_____ 424

_____ 425

_____ 426

_____ 427

_____ 428

_____ 429

_____ 430

_____ 431

_____ 432

_____ 433

_____ 434

_____ 435

_____ 436

_____ 437

_____ 438

_____ 439

_____ 440

_____ 441

_____ 442

_____ 443

_____ 444

_____ 445

_____ 446

_____ 447

_____ 448

_____ 449

_____ 450

_____ 451

_____ 452

_____ 453

_____ 454

_____ 455

_____ 456

_____ 457

_____ 458

_____ 459

_____ 460

_____ 461

_____ 462

_____ 463

_____ 464

_____ 465

_____ 466

_____ 467

_____ 468

_____ 469

_____ 470

_____ 471

_____ 472

_____ 473

_____ 474

_____ 475

_____ 476

_____ 477

_____ 478

_____ 479

_____ 480

_____ 481

_____ 482

_____ 483

_____ 484

_____ 485

_____ 486

_____ 487

_____ 488

_____ 489

_____ 490

_____ 491

_____ 492

_____ 493

_____ 494

_____ 495

_____ 496

_____ 497

_____ 498

_____ 499

_____ 500

_____ 501

_____ 502

_____ 503

_____ 504

_____ 505

_____ 506

_____ 507

_____ 508

_____ 509

_____ 510

_____ 511

_____ 512

_____ 513

_____ 514

_____ 515

_____ 516

_____ 517

_____ 518

_____ 519

_____ 520

_____ 521

_____ 522

_____ 523

_____ 524

_____ 525

_____ 526

_____ 527

_____ 528

_____ 529

_____ 530

_____ 531

_____ 532

_____ 533

_____ 534

_____ 535

_____ 536

_____ 537

_____ 538

_____ 539

_____ 540

_____ 541

_____ 542

_____ 543

_____ 544

_____ 545

_____ 546

_____ 547

_____ 548

_____ 549

_____ 550

_____ 551

_____ 552

_____ 553

_____ 554

_____ 555

_____ 556

_____ 557

_____ 558

_____ 559

_____ 560

_____ 561

_____ 562

_____ 563

_____ 564

_____ 565

_____ 566

_____ 567

_____ 568

_____ 569

_____ 570

_____ 571

_____ 572

_____ 573

_____ 574

_____ 575

_____ 576

_____ 577

_____ 578

_____ 579

_____ 580

_____ 581

_____ 582

_____ 583

_____ 584

_____ 585

_____ 586

_____ 587

_____ 588

_____ 589

_____ 590

_____ 591

_____ 592

_____ 593

_____ 594

_____ 595

_____ 596

_____ 597

_____ 598

_____ 599

_____ 600

_____ 601

_____ 602

_____ 603

_____ 604

_____ 605

_____ 606

_____ 607

_____ 608

_____ 609

_____ 610

_____ 611

_____ 612

_____ 613

_____ 614

_____ 615

_____ 616

_____ 617

_____ 618

_____ 619

_____ 620

_____ 621

_____ 622

_____ 623

_____ 624

_____ 625

_____ 626

_____ 627

_____ 628

_____ 629

_____ 630

_____ 631

_____ 632

_____ 633

_____ 634

_____ 635

_____ 636

_____ 637

_____ 638

_____ 639

_____ 640

_____ 641

_____ 642

_____ 643

_____ 644

_____ 645

_____ 646

_____ 647

_____ 648

_____ 649

_____ 650

_____ 651

_____ 652

_____ 653

_____ 654

_____ 655

_____ 656

_____ 657

_____ 658

_____ 659

_____ 660

_____ 661

_____ 662

_____ 663

_____ 664

_____ 665

_____ 666

_____ 667

_____ 668

_____ 669

_____ 670

_____ 671

_____ 672

_____ 673

_____ 674

_____ 675

_____ 676

_____ 677

_____ 678

_____ 679

_____ 680

_____ 681

_____ 682

_____ 683

_____ 684

_____ 685

_____ 686

_____ 687

_____ 688

_____ 689

_____ 690

_____ 691

_____ 692

_____ 693

_____ 694

_____ 695

_____ 696

_____ 697

_____ 698

_____ 699

_____ 700

_____ 701

_____ 702

_____ 703

_____ 704

_____ 705

_____ 706

_____ 707

_____ 708

_____ 709

_____ 710

_____ 711

_____ 712

_____ 713

_____ 714

_____ 715

_____ 716

_____ 717

_____ 718

_____ 719

_____ 720

_____ 721

_____ 722

_____ 723

_____ 724

_____ 725

_____ 726

_____ 727

_____ 728

_____ 729

_____ 730

_____ 731

_____ 732

_____ 733

_____ 734

_____ 735

_____ 736

_____ 737

_____ 738

_____ 739

_____ 740

_____ 741

_____ 742

_____ 743

_____ 744

_____ 745

_____ 746

_____ 747

_____ 748

_____ 749

_____ 750

_____ 751

_____ 752

_____ 753

_____ 754

_____ 755

_____ 756

_____ 757

_____ 758

_____ 759

_____ 760

_____ 761

_____ 762

_____ 763

_____ 764

_____ 765

_____ 766

_____ 767

_____ 768

_____ 769

_____ 770

_____ 771

_____ 772

_____ 773

_____ 774

_____ 775

_____ 776

_____ 777

_____ 778

_____ 779

_____ 780

_____ 781

_____ 782

_____ 783

_____ 784

_____ 785

_____ 786

_____ 787

_____ 788

_____ 789

_____ 790

_____ 791

_____ 792

_____ 793

_____ 794

_____ 795

_____ 796

_____ 797

_____ 798

_____ 799

_____ 800

_____ 801

_____ 802

_____ 803

_____ 804

_____ 805

_____ 806

_____ 807

_____ 808

_____ 809

_____ 810

_____ 811

_____ 812

_____ 813

_____ 814

_____ 815

_____ 816

_____ 817

_____ 818

_____ 819

_____ 820

_____ 821

_____ 822

_____ 823

_____ 824

_____ 825

_____ 826

_____ 827

_____ 828

_____ 829

_____ 830

_____ 831

_____ 832

_____ 833

_____ 834

_____ 835

_____ 836

_____ 837

_____ 838

_____ 839

_____ 840

_____ 841

_____ 842

_____ 843

_____ 844

_____ 845

_____ 846

_____ 847

_____ 848

_____ 849

_____ 850

_____ 851

_____ 852

_____ 853

_____ 854

_____ 855

_____ 856

_____ 857

_____ 858

_____ 859

_____ 860

_____ 861

_____ 862

_____ 863

_____ 864

_____ 865

_____ 866

_____ 867

_____ 868

_____ 869

_____ 870

_____ 871

_____ 872

_____ 873

_____ 874

_____ 875

_____ 876

_____ 877

_____ 878

_____ 879

_____ 880

_____ 881

_____ 882

_____ 883

_____ 884

_____ 885

_____ 886

_____ 887

_____ 888

_____ 889

_____ 890

_____ 891

_____ 892

_____ 893

_____ 894

_____ 895

_____ 896

_____ 897

_____ 898

_____ 899

_____ 900

_____ 901

_____ 902

_____ 903

_____ 904

_____ 905

_____ 906

_____ 907

_____ 908

_____ 909

_____ 910

_____ 911

_____ 912

_____ 913

_____ 914

_____ 915

_____ 916

_____ 917

_____ 918

_____ 919

_____ 920

_____ 921

_____ 922

_____ 923

_____ 924

_____ 925

_____ 926

_____ 927

_____ 928

_____ 929

_____ 930

_____ 931

_____ 932

_____ 933

_____ 934

_____ 935

_____ 936

_____ 937

_____ 938

_____ 939

_____ 940

_____ 941

_____ 942

_____ 943

_____ 944

_____ 945

_____ 946

_____ 947

_____ 948

_____ 949

_____ 950

_____ 951

_____ 952

_____ 953

_____ 954

_____ 955

_____ 956

_____ 957

_____ 958

_____ 959

_____ 960

_____ 961

_____ 962

_____ 963

_____ 964

_____ 965

_____ 966

_____ 967

_____ 968

_____ 969

_____ 970

_____ 971

_____ 972

_____ 973

_____ 974

_____ 975

_____ 976

_____ 977

_____ 978

_____ 979

_____ 980

_____ 981

_____ 982

_____ 983

_____ 984

_____ 985

_____ 986

_____ 987

_____ 988

_____ 989

_____ 990

_____ 991

_____ 992

_____ 993

_____ 994

_____ 995

_____ 996

_____ 997

_____ 998

_____ 999

_____ 1000

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 79745
Description: Crosstube Assembly	Part Number: D407-667-245
Inspection Dwg: D407-667-245 Rev: F	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.494	✓		vern	CWC-06
	1.832	+0.005/-0.000	1.834	✓		↓	
	1.838	+0.005/-0.000	1.840	✓		↓	
	1.892	+0.005/-0.000	1.892	✓		↓	
	2.052	+0.005/-0.000	2.054	✓		↓	
	2.206	+0.005/-0.000	2.208	✓		↓	
	2.521	+0.005/-0.000	2.525	✓		↓	
	2.633	+0.005/-0.000	2.637	✓		↓	
	4.10	+/-0.030	4.10	✓		vern	CWC-08
	4.978	+/-0.030	4.978	✓		↓	
	2.040	+0.000/-0.010	2.032	✓		↓	
	0.125	+/-0.010	.125	✓		↓	
	R0.063	+/-0.010	.063	✓		RG	
	R0.500	+/-0.010	.500	✓		11	
	2.490	+0.005/-0.000	2.495	✓		vern	CWC-08
SIDE B	1.832	+0.005/-0.000	1.834	✓		↓	
	1.838	+0.005/-0.000	1.841	✓		↓	
	1.892	+0.005/-0.000	1.894	✓		↓	
	2.052	+0.005/-0.000	2.056	✓		↓	
	2.206	+0.005/-0.000	2.211	✓		↓	
	2.521	+0.005/-0.000	2.526	✓		↓	
	2.633	+0.005/-0.000	2.636	✓		↓	
	4.10	+/-0.030	4.10	✓		vern	CWC-06
	4.978	+/-0.030	4.978	✓		↓	
	2.040	+0.000/-0.010	2.030	✓		↓	
	0.125	+/-0.010	.125	✓		↓	
	R0.063	+/-0.010	.063	✓		RG	
	R0.500	+/-0.010	.500	✓		11	
	112.91	+/-0.020	112.91	✓		tape	Print-02

Measured by: MAM.L	Audited by: [Signature]	Prototype Approval:	N/A
Date: 12/03/13	Date: 12-3-15	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	[Signature]

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	QTY -245	PART NUMBER	DESCRIPTION
1	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
2	1	D6011-115	CROSSTUBE
3	2	D2856-400-773	ABRASION STRIP
4	2	D2873-043	NUT PLATE
5	2	D2873-045	NUT PLATE
6	1	D2894-1	SUPPORT
7	2	D3190-1	CHAFING SHIELD
8	2	D3595-063-430	RUBBER CUSHION
9	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
10	4	MS21920-22	CLAMP
11	2	MS21920-25	CLAMP (OR MS21920-24)
12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 27.7 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, PER QSI 035.
- INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE OPPOSITE D2894-1 SUPPORT.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3; C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECN#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	90		
DRAWN	RF		
CHECKED	UP		
MFG. APPR.	SE		
APPROVED	TH		
DE APPR.			
DATE	08.11.06		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D407-667-245	REV. F SHEET 1 OF 4
TITLE CROSSTUBE ASSY (407 HIGH AFT)	SCALE NTS
COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DEO ATTACHED

RELEASED

79745 M.C.J
12102101

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

79745

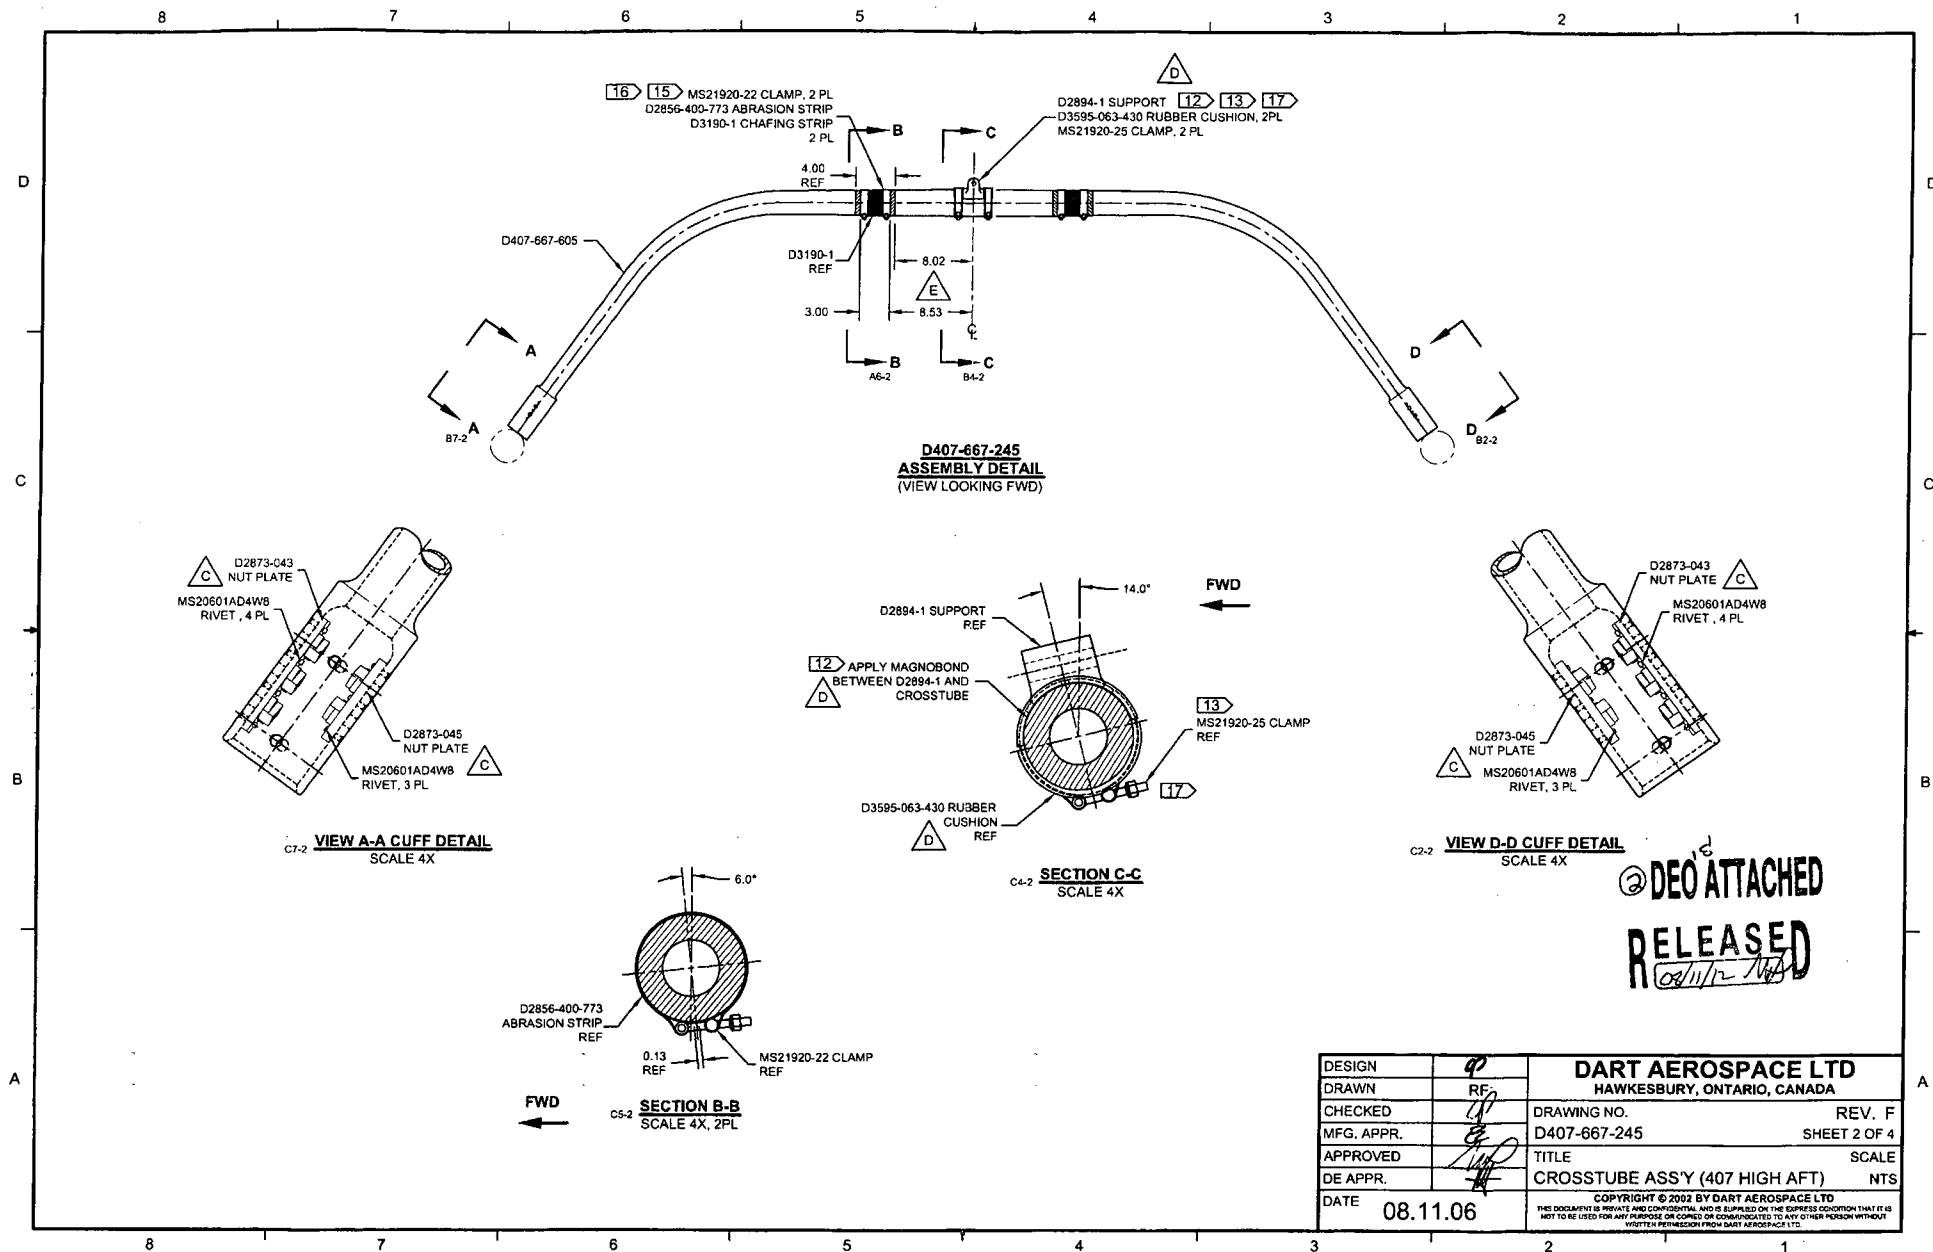

2 DEO ATTACHED
RELEASED
08/11/12

DESIGN	4	DART AEROSPACE LTD	
DRAWN	RE	HAWKESBURY, ONTARIO, CANADA	
CHECKED	UP	DRAWING NO.	REV. F
MFG. APPR.	SE	D407-667-245	SHEET 2 OF 4
APPROVED	140	TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS RECOGNITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR CORPUS OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

79745

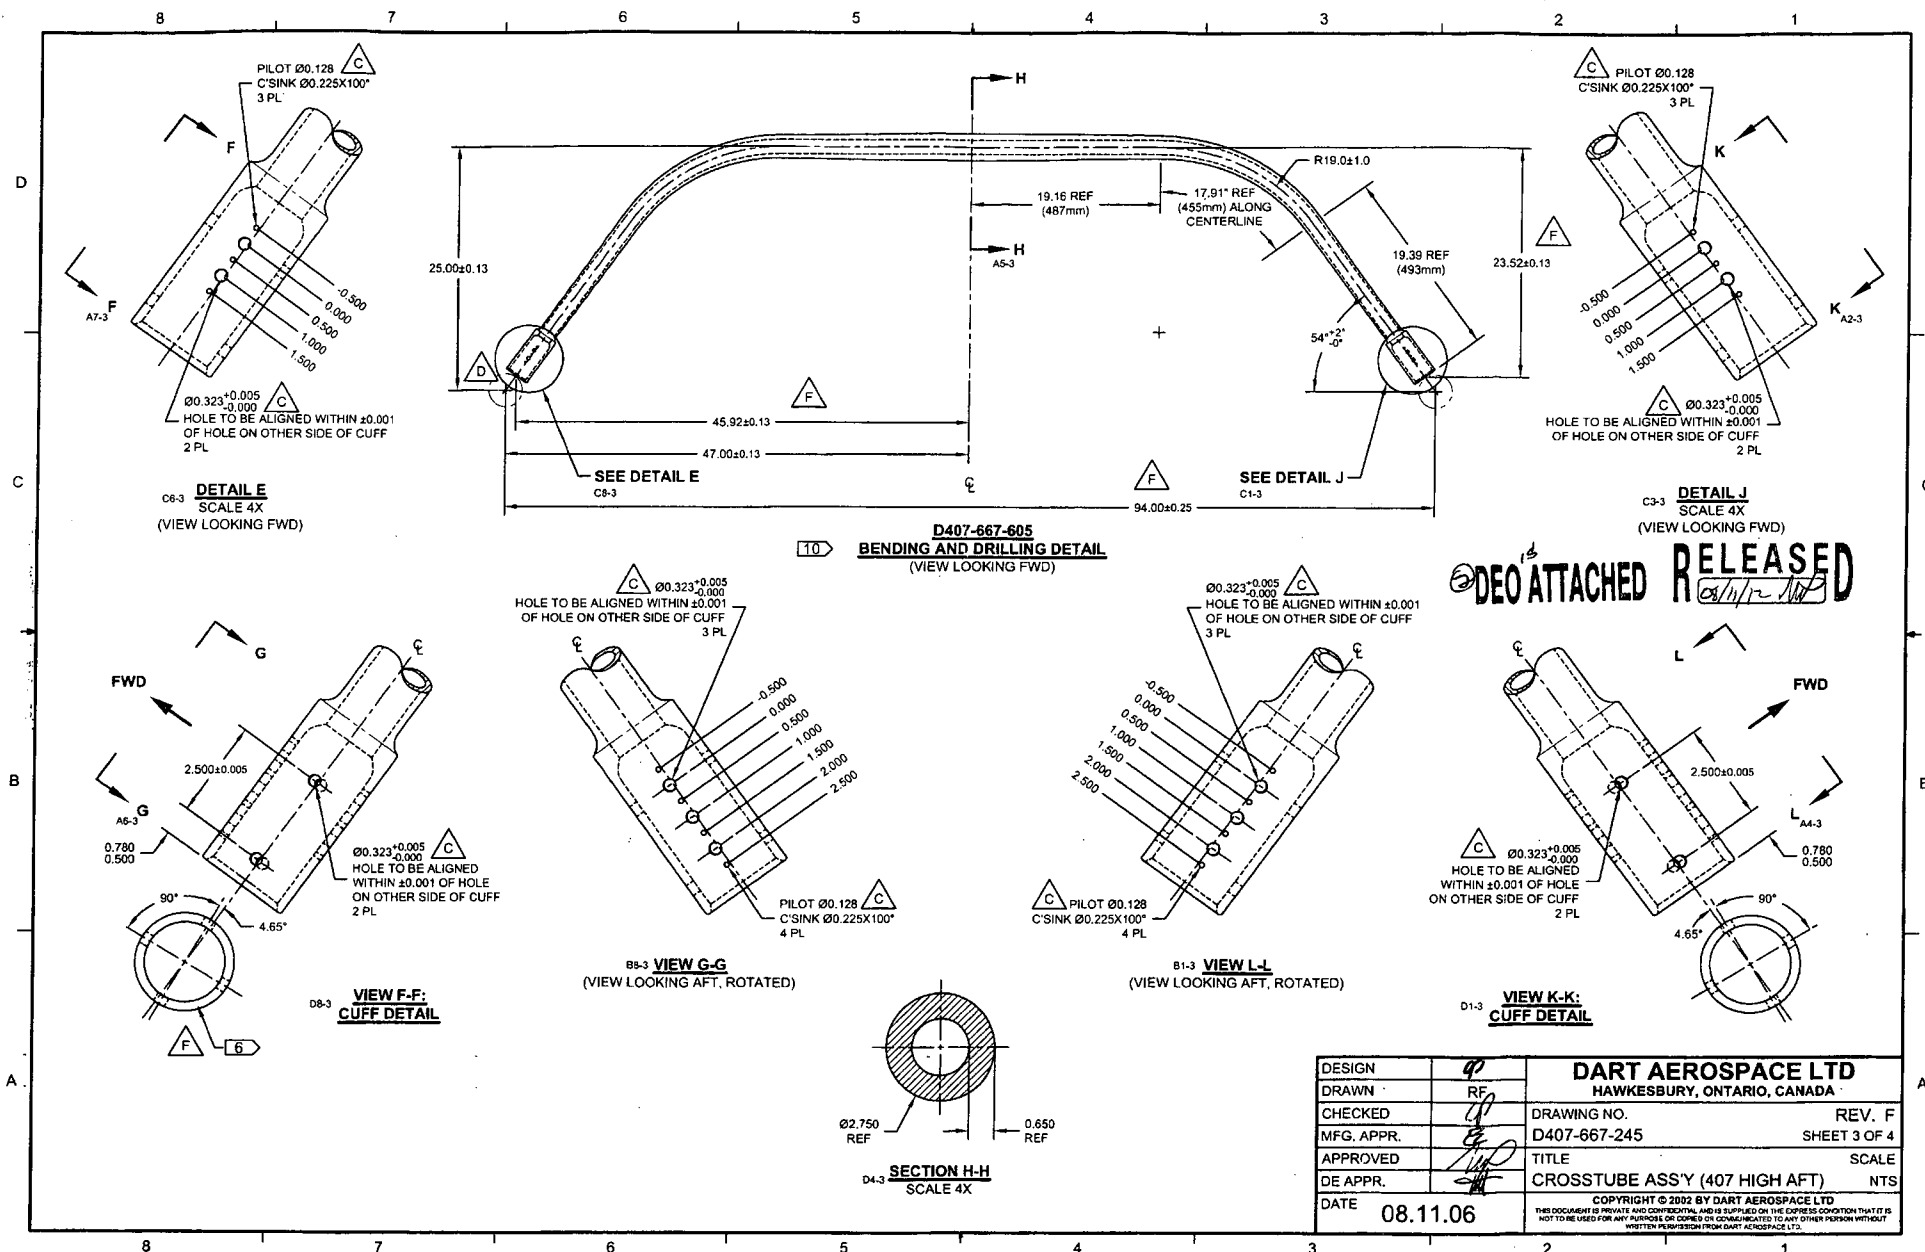

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


side A
 R1
 1- .210
 2- .229
 3- .257
 4- .290

side B
 R1
 1- .379
 2- .392
 3- .421
 4- .415

side C
 R1
 1- .219
 2- .210
 3- .249
 4- .298

side D
 R1
 1- .369
 2- .383
 3- .430
 4- .426

79745

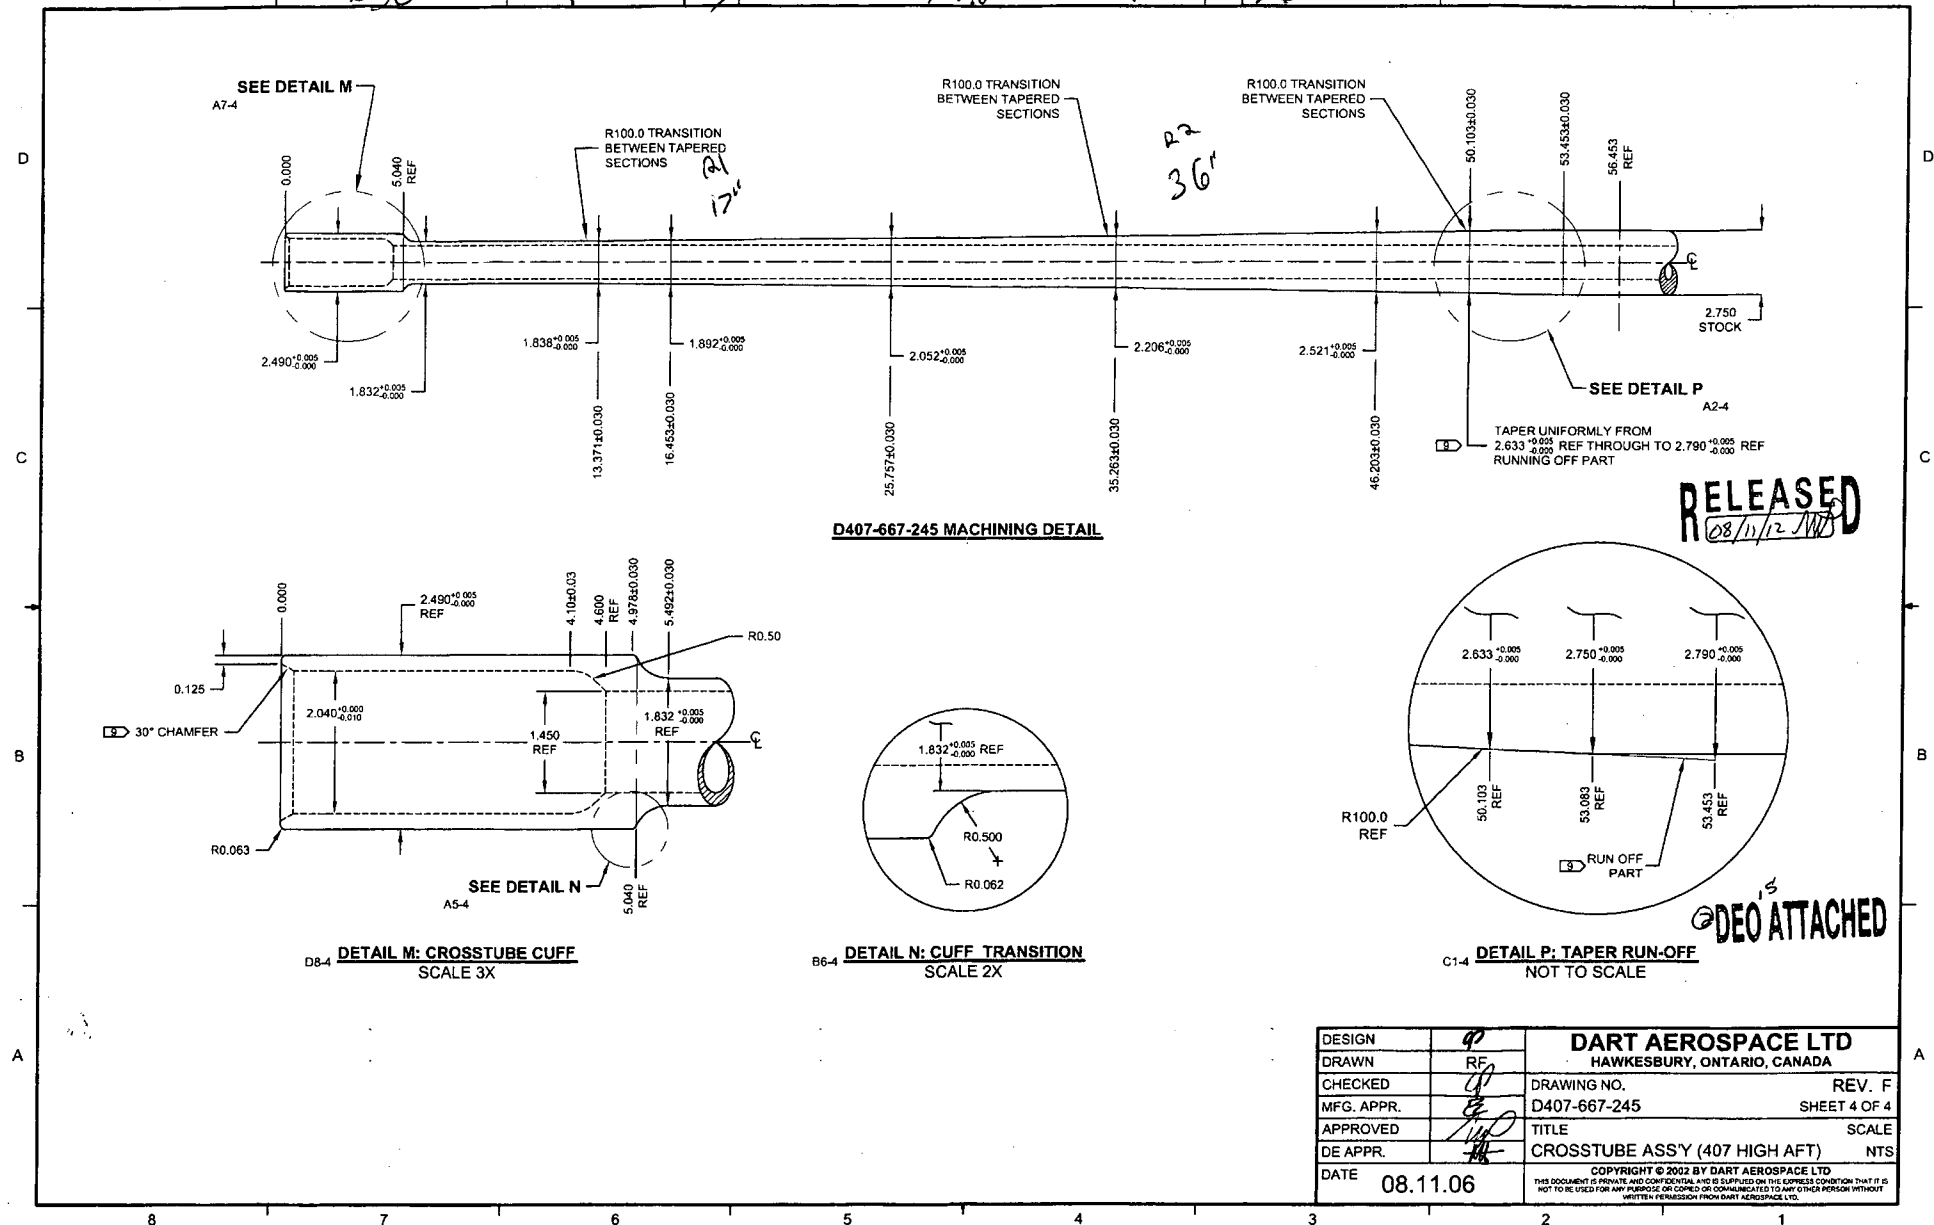

D407-667-245 MACHINING DETAIL

RELEASED
 08/11/12 JWD

DEO ATTACHED

DESIGN	4	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	4	DRAWING NO.	REV. F
MFG. APPR.	4	D407-667-245	SHEET 4 OF 4
APPROVED	4	TITLE	SCALE
DE APPR.	4	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

72745

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.08	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -245	Part Number	Description
3	0	D2856-400-773	ABRASION STRIP

WAS:

3	2	D2856-400-773	ABRASION STRIP
---	---	---------------	----------------

NOTES 2 AND 15, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1
CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEAL D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT
OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

RELEASED
2011-04-18
[Signature]

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


79745

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D407-667-245-F.1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED	UP	MFG. APPR.	APPROVED	DE APPR.	
DATE 11.04.08	DATE 11.04.11		DATE 11.04.12	DATE 11/04/12	DATE 11.04.12	

IS:

WAS:

RELEASED
2011-04-18

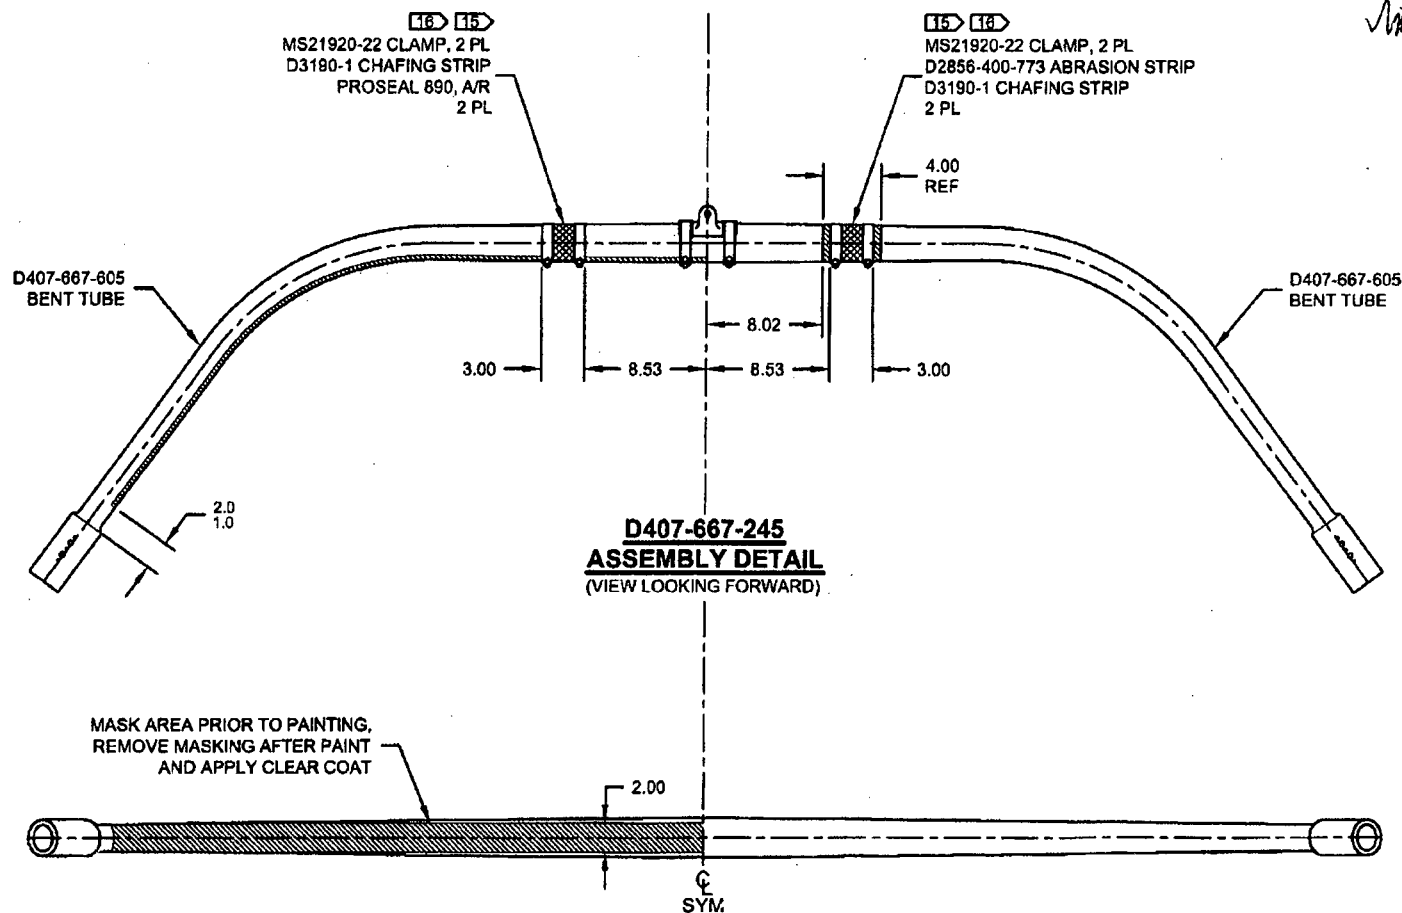

COPYRIGHT © 2011 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

7745

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASS'Y (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 97	CHECKED ASS	MFG. APPR. E	APPROVED MP		DE APPR. th		
DATE 11.09.07	DATE 11.09.15	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

Item	Qty -245	Part Number	Description
12	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
----	-----	----------------	---

NOTE 12 & 17, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
MD

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries